

Ultra Electronics

SERVICE INFORMATION LETTER

SERVICE INFORMATION LETTER LG 7/97

(Issue 1, July '97)

LANDING GEAR CONTROL AND INTERFACE UNITS 6647 SERIES

(Used on A319, A320 and A321 Aircraft)

CLARIFICATION OF CORRECT SCREW TYPE

1. Description

This Service Information Letter is applicable to all versions of the LGCIU Pt. No. **664700500A4X**. Unit failures have been attributed to fitment of screws of the incorrect length. This service information letter clarifies the length of screws to be used for the top and bottom covers.

Work carried out does not affect the function of the LGCIU.

2. Implementation

Ultra have noted that a number of units have been returned for repair with the incorrect length of screws fitted to retain the top and bottom covers. The screws fitted should be M3 x 6 LG, CSK HD (Pt No K135112503) and not M3 x 8 LG, CSK HD as used to retain the wire loom / PCB connectors.

Clarification of the above information is to be incorporated in the next revision of the CMM.

All queries relating to the information contained in this Service Information Letter should be addressed to :-

**Product Support
Ultra Electronics
Controls Division
417 Bridport Road, Greenford,
Middlesex UB6 8UA, England
Telephone +44 (0)181 813 4444 Fax +44 (0)181 813 4351**