



**PRECISION CONTROL SYSTEMS**  
417 Bridport Road  
Greenford, Middlesex  
UB6 8UE, United Kingdom  
Telephone +44 208 813 4444 Fax +44 208 813 4351  
Email: [support@ultra-pcs.com](mailto:support@ultra-pcs.com)  
(Cage: K8081)

## **SERVICE BULLETIN NO. 23-35-117**

### **INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM**

#### **GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1**

#### **1. PLANNING INFORMATION:**

##### **A. Effectivity:**

Aircraft fitted with the Elliott Sound Management System.

This Service Bulletin introduces Ground Support Software (GSS) Part No. 8-800-07-047 Issue 1 for Windows 10 operating system, which contains:

- (1) Version 1 of the Ultra Precision Control Systems Windows Based Active Noise and Vibration Control System Maintenance Terminal (ANVS MT) Software.
- (2) Version 2 of the Ultra Precision Control Systems Windows Based Event Log Extraction Tool. (Store Event Log)
- (3) Version 5 of the Advanced Maintenance Terminal (AMT) Software.
- (4) Version 1 of the Ultra Precision Control Systems Windows Based Propeller Balance Monitor System (PBMS) Software.

**Note:** Ground Support Software (GSS) Part Number. 8-800-07-047 Issue 1 is for use with Windows 10 operating systems only and is an upgrade for the existing licences using Part No. 8-800-07-040, Part No.8-800-07-030 or Part No. 8-800-07-024.



**SERVICE BULLETIN NO. 23-35-117**

**INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM**

**GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1**

**B. Concurrent Requirements:**

Not Applicable.

**C. Reason:**

- (1) Microsoft Support for Windows 7 Operating Systems (OS) ended in January 2020 with Windows 10 OS being the latest supported version. Therefore a requirement for the Active Noise and Vibration System (ANVS) Ground Support Software (GSS) to be compatible with Windows 10 OS version has been complied to allow the use of the Ground Support Software (GSS).

**D. Description:**

- (1) Ground support Software (GSS) Part No. 8-800-07-047 Issue 1 has been developed for use with 64-bit versions of Windows 10. DOSbox, an open source emulator, has been included to allow communication between the 64-bit version of Windows 10 and the AMT software operating at 16 bit.
- (2) The GSS has also been updated with the following changes.

<b>Function</b>	<b>Changes</b>
Display System Status	An Added Display of actuators and sensors that are missing from calibration data, unpressurised, pressurised or both that can result in invalid Calibration Data Error.
Automatic Actuator and Sensor Test Results	An Added Display of actuators and sensors that are missing from calibration data that can result in Failure of the ATVA or invalid Calibration Data Error.
Manual Actuator Test	An Added Display of Distortion levels for the channel being tested as per the Automatic Actuator and Sensor test.
Step-Through Actuator Test	An Added Display of Distortion levels for the channel being tested as per the Automatic Actuator and Sensor test.
Calibration	An Added Warning about distortion to the information screen shown before calibration starts.
ANCU Communications	The Error code 0x8000D30 for incorrect serial port or USB serial adaptor is not present has been replaced with the message, <b>“The serial port requested does not exist or USB serial adaptor not found”</b> .

# ULTRA

## SERVICE BULLETIN NO. 23-35-117

### INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM

#### GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1

(3) New User manual for ANVS MT Windows 10 will be available.

Ref ANVS MT 23-35-46

**E. Compliance:**

Not Applicable.

**F. Approval:**

The Technical content of this document is approved under the Authority of:  
DOA No EASA 21J.092.

**G. Manpower:**

Time to install the software from the USB Flash Drive is no more than 20 Minutes.

**H. Weight and Balance:**

Not Affected.

**I. Electrical Load:**

Not Affected.

**J. Affected Publications:**

AMT 23-35-40 R1

**K. References:**

Not Applicable.

# ULTRA

## SERVICE BULLETIN NO. 23-35-117

### INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM

#### GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1

## 2. MATERIAL INFORMATION:

### A. Material – Price and Availability:

- (1) The Software will be supplied on a USB Flash Drive (GSS Part No. 8-800-07-047 Issue 1).
- (2) Price and availability is available on request from Ultra, Precision Control Systems. (Ref Section 8)

### B. Tooling – Price and Availability:

Tooling is not required.

## 3. INSTALLATION:

### A. Installation Instructions:

- (1) Insert the USB Flash Drive (GSS Part No. 8-800-07-047 Issue 1) in to a suitable USB port. The software should run automatically.
- (2) If the Installation process does not start automatically.
  - (a) Select Start from the Windows Task Bar.
  - (b) Select File Explorer.
  - (c) Select USB Drive Typically E:
  - (d) Select Setup.
- (3) The Licence Agreement must be read and agreed to proceed.
- (4) After the set up progress has finished the Setup wizard will install the Ground Support Software 2.0.0.
- (5) The End User Licence Agreement must be read and agreed to proceed.
- (6) The default directory location where the software will be installed is **C:\MT830**.



## SERVICE BULLETIN NO. 23-35-117

### INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM

#### GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1

- (7) The settings for the ANVS MT software in the Custom Setup Menu must be changed to select the features relevant to the Aircraft you are operating.

To access the Custom Setup Menu.

- (a) Select the Windows start menu.
  - (b) Select Windows System from the menu.
  - (c) Select Control Panel.
  - (d) Select Programs and features.
  - (e) Highlight Ground Support Software 2.0.0 and click on change.
  - (f) Select change in the Ground Support Software 2.0.0 Setup window.
  - (g) Expand the PBMS Terminal software feature and select Entire Feature will be unavailable.
- (8) The settings for the AMT (Pre 83x Controller) Terminal Software in the Custom Setup menu must be changed to only select the databases relevant to the aircraft you are operating (Elliott Databases).
- (a) Expand the AMT (Pre 83x) Terminal Software feature and expand the Pre 83x Controller software feature.
  - (b) The appropriate Pre 83x Controller software database can be installed by clicking on the drop down box at the side of each feature.
  - (c) Select will be installed on local hard drive to install the feature.
  - (d) Select Entire feature will be unavailable if the feature is not required.
  - (e) To install the Elliott databases please ensure that Dash 8/SAAB databases feature is set to Entire feature will be unavailable and only the Elliott databases feature is set to will be installed on the local hard drive.

**Note:** Only select the database relevant to the aircraft you are operating.

- (f) Select the Next button and follow the on-screen prompts to begin the installation.

# ULTRA

## SERVICE BULLETIN NO. 23-35-117

### INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM


#### GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1

(9) The Default COM port allocation for the USB to Serial port adapter is COM port 2  
Select the next button to continue.

(10) When the installation is complete, Disconnect the USB drive safely, remove and store.

#### 4. GETTING STARTED:

**Figure 1** shows the four icons that will be installed on the desktop following installation of the Ground Support Software (GSS).

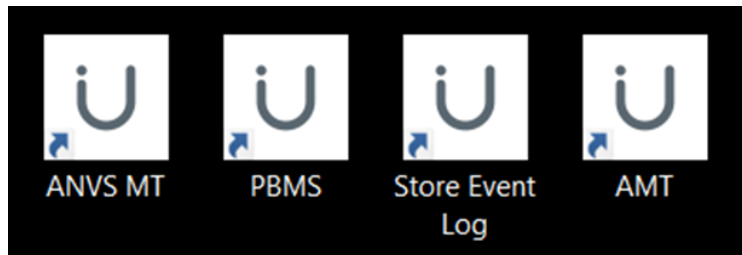

**Figure 1**

##### A. ANVS MT:

ANVS MT is the Active Noise and Vibration Control System Maintenance Terminal Software to be used with 83x type controllers.

##### B. PBMS:

PBMS is the Propeller balance Monitoring System Software to be used with 832 type controllers on aircraft fitted with PBMS.

##### C. Store Event Log:

Store Event log is the Event Log Extraction Tool Which can be used to download an event log from 83x type controllers.

##### D. AMT:

AMT is the Advanced Maintenance Terminal Software to be used with a Type 81x or 82x controller. If the ANVS MT is used on a Type 81x or 82x controller, this will be recognised and the AMT will automatically start.

# ULTRA

## SERVICE BULLETIN NO. 23-35-117

### INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM

#### GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1

#### 5. REGISTRATION INSTRUCTIONS:

##### A. Registering the ANVS MT Software:

This process must be followed the first time the ANVS MT software is started after installation or after the ANVS MT licence has expired.

- (1) Double click on the icon for ANVS MT.
- (2) After a few seconds, the Welcome screen will be shown followed by the Registration Check screen.
- (3) Call or Email Ultra Precision Control Systems (Ref Section 8 below for Contact Details) for your ANVS MT Authorisation Code. You will need to give the following information.
  - (a) Your name and Company Name.
  - (b) The Software Licence Number from the Identification tag on the USB Flash Drive.
  - (c) The Registration Number shown on the Registration Check Screen.
  - (d) A contact telephone number and Email address.

**Note:** Keep a record of the Expiration Date given with the ANVS MT Authorisation Code to enable a renewal to be scheduled.

- (4) Once you have obtained the Authorisation code, press <ENTER>. The software Registration screen will be shown.
- (5) Enter the Software Licence Number and use the cursor keys to select the Authorisation code field.
- (6) Enter the Authorisation Code supplied by Ultra Precision Controls Systems, and press the <ENTER> key.
- (7) If successful, a window will appear stating “**Licence and Authorisation Code Accepted**”. If not connected to a controller, you may now exit the ANVS MT software.

# ULTRA.

## SERVICE BULLETIN NO. 23-35-117

### INTRODUCTION OF WINDOWS 10 BASED GROUND SUPPORT SOFTWARE FOR USE WITH AIRCRAFT FITTED WITH THE ELLIOTT SOUND MANAGEMENT SYSTEM

#### GROUND SUPPORT SOFTWARE PART NO. 8-800-07-047 ISSUE 1

(8) The registration process is now complete and the ANVS MT software is ready for use.

#### 6. MODIFICATION STATUS:

This change does not affect the modification standard of any system component.

#### 7. DOCUMENTATION:

Not applicable.

#### 8. FURTHER INFORMATION:

If you need more information about this Service Bulletin, please contact the Customer Support Manager at:

**Ultra, Precision Control Systems**  
**417 Bridport Road, Greenford, Middlesex**  
**UB6 8UE**  
**United Kingdom**

**Telephone: +44 (0) 20 8813 4444      Fax: +44 (0) 20 8813 4351**  
**Email: [support@ultra-pcs.com](mailto:support@ultra-pcs.com)**